


2013 Ford Explorer Police Interceptor

2013 ACCESSORIES & BODY, CAB Parking Aid System - Explorer

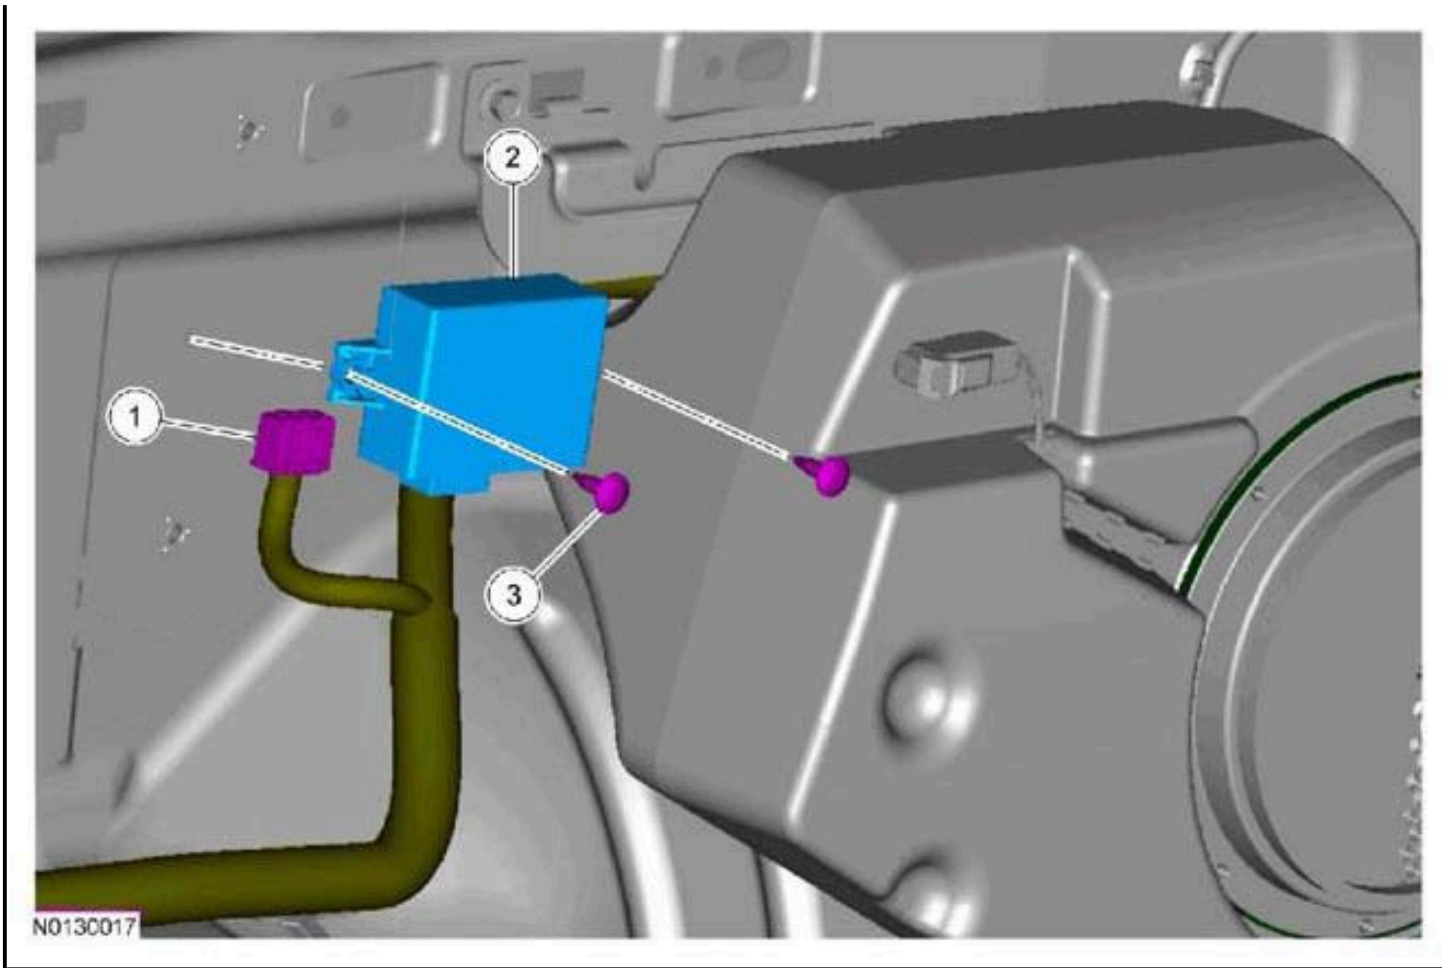

Item	Service Part Number	Description	Torque	Material Name	Notes
1	14A005	Parking Aid Module (PAM) electrical connector	-	-	-
2	15K866	Parking Aid Module (PAM)	-	-	-
3	W705635	Parking Aid Module (PAM) screw (2 required)	3 Nm (27 lb-in)	-	-

Removal

1. **NOTE:** Module configuration is required when a new PAM is being installed.

Upload the module configuration information from the PAM into the scan tool by following the instructions on the scan tool.

2. Position aside the liftgate weatherstrip.

NOTE: To avoid damage to the liftgate scuff plate trim panel, remove any

- 3.